



Airbus Helicopters Inc.
Technical Support
2701 Forum Drive
Attn: Dave Vogel
Grand Prairie, TX 75052

August 21, 2018

Subject: **GLOBAL AMOC for AD 2000-26-06**
Attachments: AD 2000-26-06 Effective date February 26, 2001
GLOBAL AMOC LETTER 2017-03-01 August 20, 2018

To all BK117 A1 through C1 operators,

There has been a revision to the BK117 A1 through B2 Maintenance Manual, now Rev. 46 and to the BK117C1 Maintenance Manual, now Rev. 29. In both of these revisions the Service Life Limit of the tension torsion straps with PN 117-14111 has been raised to 12 years or 40,000 flights. Previously the Service Life Limit was 12 years or 25,000 flights.

On Monday August 20th, 2018 a revised AMOC was granted by the FAA for the tension torsion straps that have had an update to the SLL from 12 years or 25,000 flights to 12 years or 40,000 flights.

The AMOC is transferable with the helicopter to any operator who operates under US authority. Before using the AMOC please notify your appropriate principal inspector, or local flight standards district office.

If you have any questions, please contact Dave Vogel at Airbus Helicopters Inc.

Best regards,

Ken ARNOLD
Manager, Field Service/Technical Support
Technical Support
Office: (972) 641-3556
Mobile (817) 909-5209
Fax: (972)641-3710
E mail: ken.arnold@airbus.com
Airbus Helicopters, Inc
2701 N.Forum Drive
Grand Prairie, TX 75052

Dave Vogel
Sr. Technical Representative
BO105/BK117/EC135/EC145
Airbus Helicopters Inc.
Grand Prairie, TX 75052-7099
T 972-641-3573
M 817-201-1196
E dave.vogel@airbus.com
www.airbushelicoptersinc.com



U.S. Department
of Transportation
**Federal Aviation
Administration**

Southwest Region
Arkansas, Louisiana,
New Mexico, Oklahoma,
Texas

Fort Worth, Texas 76177

August 20, 2018

Mr. Dave Vogel
Senior, Technical representative
Airbus Helicopter Inc.
2701 N. Forum Dr.
Grand Prairie, TX 75052-7099

Dear Mr. Vogel,

We received your proposal for a Global Alternate Method of Compliance (AMOC), dated May 8, 2018, to paragraph (a) of Airworthiness Directive (AD) 2000-26-06 (directorate identifier 99-SW-67-AD). The AD applies to Airbus Helicopters Deutschland GmbH (Airbus Helicopters) Model MBB-BK 117 A-1, A-3, A-4, B-1, B-2 and C-1 helicopters.

Airbus Helicopters increased the life limit of the tension torsion strap part number (P/N) 117-14111 from 12 years or 25,000 flights to 12 years or 40,000 flights, whichever occurs first, through the use of historical service life of the part and by analysis. The new life limits are listed in the current version of the helicopter Maintenance Service Manual (MSM).

You requested that the life limits mandated by AD 2000-26-06 paragraphs (a)(4)(b) and (a)(4)(c) not apply to tension torsion strap P/N 117-14111, and that the new life limit for the tension torsion strap P/N 117-14111 be set to 12 years or 40,000 flights, whichever occurs first, in accordance with the current approved version of the MSM.

Your AMOC is Federal Aviation Administration (FAA) approved for paragraphs (a)(4)(b) and (a)(4)(c).

This FAA AMOC is transferable with the aircraft to an operator who operates the aircraft under U.S. registry.

Before using this AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

All provisions of AD 2000-26-06 that are not specifically referenced above remain fully applicable and must be complied with accordingly.

This AMOC only applies to the FAA AD listed above. The FAA does not have the authority to approve this as an AMOC to any AD issued by another civil aviation authority (CAA).

Approval of an AMOC to another CAA's AD must come from that CAA. A copy of this response will be forwarded to the CAA where these aircraft are registered for their consideration.

If there are any questions regarding this approval, please contact Matthew Fuller by mail, telephone (817) 222-5161, or email matthew.fuller@faa.gov.

Thank you,

A handwritten signature in black ink, appearing to read "Stephen Barbini".

Stephen Barbini
Manager, Safety Management Section
Policy & Innovation Division
Aircraft Certification Service

Cc: Fort Worth FSDO, Fort Worth AEG

▼ **Header Information**

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39 [66 FR 6453 1/22/2001]

Docket No. 99-SW-67-AD; Amendment 39-12056; AD 2000-26-06

RIN 2120-AA64

Airworthiness Directives; Eurocopter Deutschland GMBH Model MBB-BK 117 Helicopters
PDF Copy (If Available):

▼ **Preamble Information**

AGENCY: Federal Aviation Administration, DOT

ACTION: Final rule

SUMMARY: This amendment supersedes an existing airworthiness directive (AD) that applies to Eurocopter Deutschland GMBH (ECD) Model MBB-BK 117 helicopters. That AD currently requires, before further flight, creating a component log card or equivalent record and determining the calendar age and number of flights on each tension-torsion (TT) strap. This amendment establishes a life limit for certain main rotor TT straps. This amendment is prompted by an accident in which a main rotor blade (blade) separated from an ECD Model MBB-BK 117 helicopter due to fatigue failure of a TT strap. The actions specified by this AD are intended to prevent fatigue failure of a TT strap, loss of a blade, and subsequent loss of control of the helicopter.

DATES: Effective February 26, 2001.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of February 26, 2001.

ADDRESSES: The service information referenced in this AD may be obtained from American Eurocopter Corporation, 2701 Forum Drive, Grand Prairie, Texas 75053-4005, telephone (972) 641-3460, fax (972) 641-3527. This information may be examined at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Charles Harrison, Aviation Safety Engineer, FAA, Rotorcraft Directorate, Rotorcraft Standards Staff, Fort Worth, Texas 76193-0110, telephone (817) 222-5128, fax (817) 222-5961.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) by superseding AD 2000-01-11, Amendment 39-11509 (65 FR

2017, January 13, 2000), which applies to ECD Model MBB-BK 117 helicopters, was published in the **Federal Register** on September 18, 2000 (65 FR 56275). That action proposed establishing a life limit for the TT straps of 120 months since installation on any helicopter or 25,000 flights, whichever occurs first.

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were received on the proposal or the FAA's determination of the cost to the public. The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

The FAA estimates that 127 helicopters of U.S. registry will be affected by this AD, that it will take approximately 16 work hours per helicopter to accomplish the required actions, and that the average labor rate is \$60 per work hour. Required parts will cost approximately \$10,400 per helicopter. Based on these figures, the total cost impact of the AD on U.S. operators is estimated to be \$1,442,720.

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption "ADDRESSES."

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by removing Amendment 39-11509 (65 FR 2017, January 13, 2000), and by adding a new airworthiness directive (AD), Amendment 39-12056, to read as follows:

▼ Regulatory Information

2000-26-06 EUROCOPTER DEUTSCHLAND GMBH: Amendment 39-12056. Docket No. 99- SW-67-AD. Supersedes AD 2000-01-11, Amendment 39-11509, Docket No. 99-SW-60-AD. Applicability: Model MBB-BK 117 A-1, A-3, A-4, B-1, B-2, and C-1 helicopters, certificated in any category.

NOTE 1: This AD applies to each helicopter identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For helicopters that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (d) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent fatigue failure of a tension-torsion (TT) strap, loss of a main rotor blade (blade), and subsequent loss of control of the helicopter, accomplish the following:

(a) Before further flight,

(1) Remove TT straps, P/N 2604067 (Bendix) or J17322-1 (Lord), from service or re- identify them as P/N 117-14110 or 117-14111, respectively, in accordance with the Accomplishment Instructions, paragraph 2.B.1.2., Eurocopter Deutschland GMBH Alert Service Bulletin MBB-BK- 117 No. ASB-MBB-BK 117-10-120, Revision 1, dated August 31, 1999 (ASB). TT straps, P/N 2604067 (Bendix) or J17322-1 (Lord), are no longer eligible for installation.

(2) Create a component log card or equivalent record for each TT strap.

(3) Review the history of the helicopter and each TT strap. Determine the age since initial installation on any helicopter (age) and the number of flights on each TT strap. Enter both the age and the number of flights for each TT strap on the component log card or equivalent record. When the number of flights is unknown, multiply the number of hours time-in-service (TIS) by 5 to determine the number of flights.

(4) Remove any TT strap from service if the total hours TIS or number of flights and age cannot be determined.

(b) Before further flight, remove any TT strap, part number (P/N) 117-14110 or 117-14111, that has been in service 120 months since initial installation on any helicopter or accumulated 25,000 flights (a flight is a takeoff and a landing). Replace the TT strap with an airworthy TT strap.

(c) This AD revises the Airworthiness Limitations Section of the maintenance manual by establishing a life limit for the TT strap, P/N 117-14110 and 117-14111, of 120 months or

25,000 flights, whichever occurs first.

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Regulations Group, Rotorcraft Directorate, FAA. Operators shall submit their requests through an FAA Principal Maintenance Inspector, who may concur or comment and then send it to the Manager, Regulations Group.

NOTE 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Regulations Group.

(e) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the helicopter to a location where the requirements of this AD can be accomplished.

(f) The modification shall be done in accordance with the Accomplishment Instructions, paragraph 2.B.1.2., Eurocopter Deutschland GMBH Alert Service Bulletin MBB-BK-117 No. ASB- MBB-BK 117-10-120, Revision 1, dated August 31, 1999. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from American Eurocopter Corporation, 2701 Forum Drive, Grand Prairie, Texas 75053-4005, telephone (972) 641-3460, fax (972) 641-3527. Copies may be inspected at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(g) This amendment becomes effective on February 26, 2001.

NOTE 3: The subject of this AD is addressed in the Luftfahrt Bundesamt (Federal Republic of Germany) AD 1999-284/2, dated September 1, 1999.

▼ **Footer Information**

Issued in Fort Worth, Texas, on December 15, 2000.
Henry A. Armstrong,
Manager, Rotorcraft Directorate,
Aircraft Certification Service.

▼ **Comments**